AUREON
Kitchen Exhaust Cleaning

KITCHEN EXHAUST CLEANING REPORT

Reporte de limpieza de campanas · per NFPA 96

SAMPLE · ILLUSTRATIVE DATA

Report no. · Reporte	Service date · Fecha	Time in / out · Entrada / salida	Report sent · Enviado
AUR-SAMPLE-001	**Jan 14, 2027**	**11:05 p.m. – 2:40 a.m.**	**8:12 a.m.**

1 Customer & site Cliente y sitio

Business	**Sample Kitchen (example)**	City	**Summit County, CO**
Contact	**Kitchen manager**	Language	**English / Español**

2 Service Servicio

Crew	**Technician A (lead) + Technician B**	Cooking volume	**Moderate · every 6 months**
Previous cleaning	**July 2026 (other provider)**	Next cleaning due	**July 2027**
Service tag on hood	**Yes**	Photos and videos	**46 (44 photos + 2 videos)**

3 Components Componentes

COMPONENT	QTY / FT	RESULT	NOTES
Hood canopy Campana	1 · 8 ft	Bare metal	
Filters Filtros	6 baffle	Cleaned, reinstalled with no gaps	1 bent filter: replace (quote attached)
Hood plenum Pleno	—	Bare metal	
Vertical duct Ducto vertical	14 ft	Bare metal	
Horizontal duct Ducto horizontal	18 ft	Partial	3 ft above the walk-in cooler not reachable: no access panel (S01)
Exhaust fan Ventilador	1 upblast	Cleaned, tested on video	Belt and bearings sound normal
Fan hinge kit Bisagra	—	Not present	Recommended: $265 installed
Rooftop grease containment Contención en techo	—	Not present	Light grease on roof: recommended, from $585

4 Areas not cleaned Áreas no limpiadas · NFPA 96 11.6.14

Horizontal duct, 3 ft above the walk-in cooler. No access panel, so it could not be reached safely. Photo S01. To clean it next time: install one access panel (quote attached, only with your written approval).


SAMPLE

PHOTOS BY SECTION

Fotos por sección · same angle before and after


SAMPLE · ILLUSTRATIVE DATA


5 Before and after Antes y después · 3 of 22 pairs shown

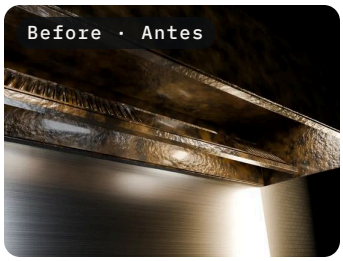




C04 · Hood plenum · Pleno

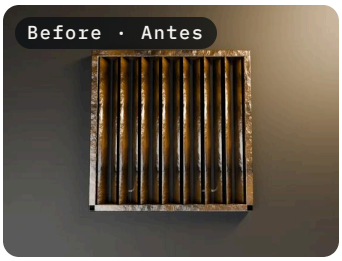

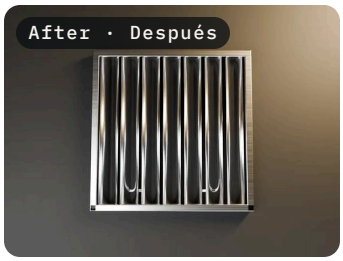

F01 · Baffle filter · Filtro



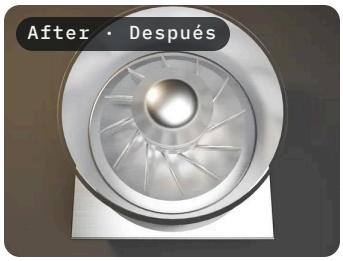

V02 · Exhaust fan · Ventilador

This sample uses 3D illustrations. Real reports carry photos of your own kitchen, named by section code (L, C, F, V, S, X).

6 Findings and recommendations Hallazgos y recomendaciones

- ☑ Missing duct access panel (S01)
- ☑ Exhaust fan not hinged
- ☑ Light grease on roof
- ☑ One damaged filter
- ☐ Fan belt, bearing or motor problem
- ☐ Duct leaks or open seams
- ☐ Fire suppression tag expired (refer to licensed company)
- ☐ Excessive build-up for current frequency

7 Certification Certificación

AUREON certifies that the kitchen exhaust system identified above was cleaned on the date shown, following NFPA 96, except for the areas listed in section 4. Copy left on premises and sent to the customer by email.

Technician A · signature (sample)

Customer · signature (sample)

SAMPLE · F